

Electrical Survey - South Side



Company	Widget Manufacturing	Tester:
	123 Industrial Way	Joe Electrician
	Bensonville, USA 23456	Phone: 432-234-5678

Device	Testo 880-3
---------------	-------------

Customer	Widget Manufacturing	Measuring Site:
		Same
		Measuring Date: 3/10/2008

Task	Survey South Side Electrical Room
-------------	-----------------------------------






Electrical Survey - South Side

File:
Breaker #35.bmt

Date:
2/18/2008

Measuring Time:
12:44:41 PM

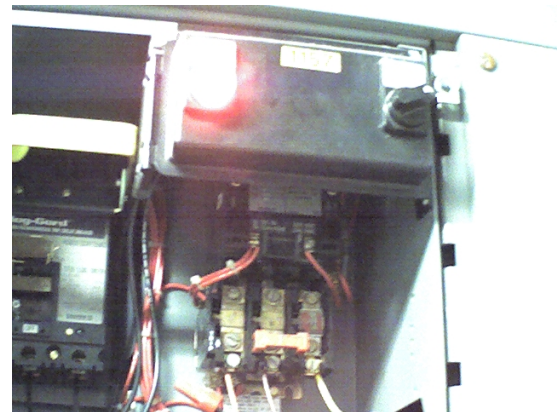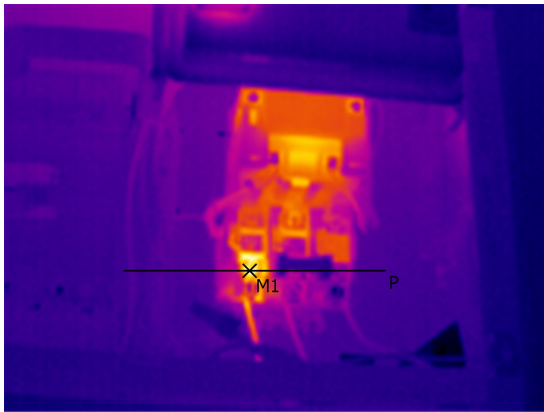

Picture parameters:


Emissivity: 0.95

Refl. temp. [°F]: 65.0

Picture markings:

Measurement Objects	Temp. [°F]	Emiss.	Refl. temp. [°F]	Remarks
Measure point 1	149.7	0.95	64.9	Hot phase connection - Loose?

Profile line:

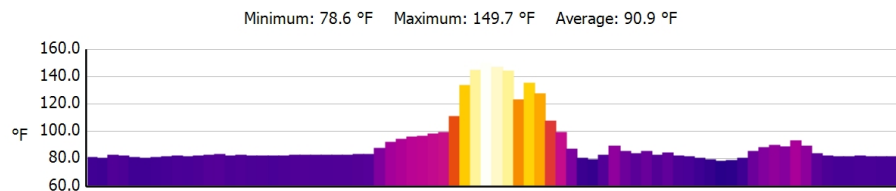




Electrical Survey - South Side

File:
Hot Connection.bmt

Date:
2/18/2008

Measuring Time:
10:57:53 AM



Picture parameters:

Emissivity: 0.95

Refl. temp. [°F]: 64.9

Picture markings:

Measurement Objects	Temp. [°F]	Emiss.	Refl. temp. [°F]	Remarks
Measure point 1	134.1	0.95	64.9	Single phase hot -Fuse Box #38

Review:

Highlighted problem areas need to be checked at next maintenance turnaround

3/18/2008 , _____

Joe Electrician